

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.58	03/12/2018 03/12/2018	Maksim Khashchuk

LM Start		Rating **	A	Issue No.	6
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Flood Preparedness & Training			°	°
				°	°
DWR ID	DWR_RD2058_01_s_2013_6				
Comment Code					
Inspector Comment					
The LMA has current flood fight training.					

No Photos

LM Start		Rating **	A	Issue No.	7
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Emergency Supplies & Equipment			°	°
				°	°
DWR ID	DWR_RD2058_01_s_2013_7				
Comment Code					
Inspector Comment					
Flood fight supplies are available on-site at the office.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.58	03/12/2018 03/12/2018	Maksim Khashchuk

LM Start		Rating **	A	Issue No.	9
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Operations & Maintenance Manuals			°	°
				°	°
DWR ID	DWR_RD2058_01_s_2013_9				
Comment Code					
Inspector Comment					
The O&M Manual is available at the district office.					

No Photos

LM Start	0.03	Rating **	C	Issue No.	22
LM End	0.22	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		37.801905°	37.804173°	
			-121.420544°	-121.418646°	
DWR ID	DWR_RD2058_01_f_2017_22				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

LM Start	0.22	Rating **	C	Issue No.	24
LM End	0.29	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		37.804174°	37.804738°	
			-121.418646°	-121.417469°	
DWR ID	DWR_RD2058_01_f_2017_24				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.58	03/12/2018 03/12/2018	Maksim Khashchuk

LM Start	0.23	Rating **	M	Issue No.	4
LM End	0.23	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			37.804351 °	37.804351 °
				-121.418433 °	-121.418433 °
DWR ID	DWR_RD2058_01_f_2013_4				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Wild rose on the levee. This area is riparian rabbit habitat.					

Photo 1 of 1 : SP_2018_RD2058_111_4_20180305_00005.jpg



View of the wild rose on the levee slope obstructing visibility and access.

LM Start	0.37	Rating **	C	Issue No.	31
LM End	0.69	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			37.804255 °	37.801850 °
				-121.416306 °	-121.411562 °
DWR ID	DWR_RD2058_01_f_2017_31				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.58	03/12/2018 03/12/2018	Maksim Khashchuk

LM Start	0.37	Rating **	A	Issue No.	32
LM End	2.12	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			37.804255 °	37.803859 °
				-121.416302 °	-121.386171 °
DWR ID	DWR_RD2058_01_f_2017_32				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					
Acceptable vegetation control on the levee slope.					

Photo 1 of 1 : SP_2018_RD2058_111_32_20180314_00064.jpg



View of the acceptable vegetation control on the levee slope.

LM Start	0.55	Rating **	M	Issue No.	21
LM End	0.55	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			37.802369 °	37.802369 °
				-121.413902 °	-121.413902 °
DWR ID	DWR_RD2058_01_s_2017_21				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					

Photo 1 of 1 : SP_2018_RD2058_111_21_20180305_00013.jpg



View of the tree that needs to be trimmed.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.58	03/12/2018 03/12/2018	Maksim Khashchuk

LM Start	0.72	Rating **	A/W	Issue No.	976	
LM End	0.72	Issue Type +	Ma	Location *		
Category	Supplemental			GPS Latitude/Longitude		
				Start		End
Item	DWR UCIP LMA Responsibility			37.801792 °		37.801792 °
				-121.410921 °		-121.410921 °
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:45143 DS_ID:22704 EP_NO: N/A Repair Type: No Action Needed Crossing Status: Found UCIP Comments: FIELD_STRUCT_DESC: *ABANDONED* 12-inch drainage discharge pipe of an unknown material through the levee, 18 feet below the crown. Pump on the landside (LS). Flap gate on the waterside (WS). (To abandon the existing 12-inch pipe with concrete and install a new 16-inch pipe authorized under Permit No. 5055, 1965 - Stanley Electric Motor Company). 12-inch pipe grouted in place. [Additional Reference(s): DWR Levee Log, 2005. USACE San Joaquin O&M Manual 10, March 1964, (HLM 0.72)]. FS Date: 5/12/2015						

Photo 1 of 1 : UCIP_SP_2018_45143_45168.jpg



LS view: an abandoned pipe found in concrete sump.

LM Start	0.75	Rating **	A	Issue No.	35
LM End	2.12	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			37.801742 °	37.803859 °
				-121.410323 °	-121.386171 °
DWR ID	DWR_RD2058_01_f_2017_35				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					
Acceptable vegetation control on the levee slope.					

Photo 1 of 1 : SP_2018_RD2058_111_35_20180314_00065.jpg



View of the acceptable vegetation control on the levee slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.58	03/12/2018 03/12/2018	Maksim Khashchuk

LM Start	1.22	Rating **	U	Issue No.	978
LM End	1.22	Issue Type +	Ma	Location *	
Category	Supplemental		GPS Latitude/Longitude		
			Start	End	
Item	DWR UCIP LMA Responsibility		37.802301 °	37.802301 °	
			-121.401977 °	-121.401977 °	
DWR ID					

Comment Code

Inspector Comment

FS_ID:51161
DS_ID:22694
EP_NO: 11546
Repair Type: Urgent
Crossing Status: Found
UCIP Comments: 11/29/2016 Heavy erosion still present. Could be due to wave run-up as this is the only spot on levee not rock revetted. Greg Pombo (RD2058) indicated permits for endangered species prevent rock revetment. (K. Fazel - UCIP)05/12/2015 Erosion on west side of pipe at W/S toe. (K. Fazel - UCIP)
FIELD_STRUCT_DESC: 1 of 2: 18-inch steel drainage discharge pipe through the levee, 2 feet below the crown. Pump in drainage ditch on the landside (LS). Siphon breaker with cover on the waterside (WS) shoulder. Electrical service pole at the LS toe. (18-inch pipe and pump authorized under Permit No. 11546, 1976 - Reclamation District No. 2058). [Additional Reference(s): DWR Levee Log, 2005].
FS Date: 11/29/2016

LM Start	1.22	Rating **	U	Issue No.	978 (cont)
LM End	1.22	Issue Type +	Ma	Location *	

Photo 1 of 3 : UCIP_SP_2018_51161_45171.jpg



WS view: siphon breaker hole. Siphon breaker removed for repair.

Photo 2 of 3 : UCIP_SP_2018_51161_45170.jpg



LS view: pipe, pile structure, and pump platform in drain ditch.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.58	03/12/2018 03/12/2018	Maksim Khashchuk

LM Start	2.12	Rating **	A/W	Issue No.	979
LM End	2.12	Issue Type +	Ma	Location *	
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			37.803892 °	37.803892 °
				-121.386299 °	-121.386299 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:45865 DS_ID:22705 EP_NO: N/A Repair Type: No Action Needed Crossing Status: Found UCIP Comments: FIELD_STRUCT_DESC: 20-inch steel drainage discharge pipe through the levee, 8 feet below the crown. Pump on a concrete sump in a drainage ditch on the landside (LS) toe. Siphon breaker on the waterside (WS) shoulder. [Additional Reference(s): USACE San Joaquin O&M Manual 10, March 1964, (HLM 2.14), 18-inch pipe referenced]. FS Date: 5/12/2015					

Photo 1 of 3 : UCIP_SP_2018_45865_74323.jpg



Siphon breaker on WS shoulder inside protective riser.

LM Start	2.12	Rating **	A/W	Issue No.	979 (cont)
LM End	2.12	Issue Type +	Ma	Location *	

Photo 2 of 3 : UCIP_SP_2018_45865_74324.jpg



Pipe just visible at WS toe at center of photograph.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.58	03/12/2018 03/12/2018	Maksim Khashchuk

LM Start	2.12	Rating **	A/W	Issue No.	979 (cont)
LM End	2.12	Issue Type +	Ma	Location *	
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			37.803892 °	37.803892 °
				-121.386299 °	-121.386299 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:45865 DS_ID:22705 EP_NO: N/A Repair Type: No Action Needed Crossing Status: Found UCIP Comments: FIELD_STRUCT_DESC: 20-inch steel drainage discharge pipe through the levee, 8 feet below the crown. Pump on a concrete sump in a drainage ditch on the landside (LS) toe. Siphon breaker on the waterside (WS) shoulder. [Additional Reference(s): USACE San Joaquin O&M Manual 10, March 1964, (HLM 2.14), 18-inch pipe referenced]. FS Date: 5/12/2015					

Photo 3 of 3 : UCIP_SP_2018_45865_74325.jpg



Pump on concrete pad at LS toe.

LM Start	2.12	Rating **	M	Issue No.	980
LM End	2.12	Issue Type +	Ma	Location *	
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			37.803886 °	37.803886 °
				-121.386271 °	-121.386271 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:51699 DS_ID:22706 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: Leaky and damaged siphon breaker on waterside shoulder.. FIELD_STRUCT_DESC: 16-inch steel drainage discharge pipe through the levee, 8 feet below the crown. Pump on a concrete sump in a drainage ditch on the landside (LS) toe. Siphon breaker on the waterside (WS) shoulder. [Additional Reference(s): USACE San Joaquin O&M Manual 10, March 1964, (HLM 2.14), 12-inch pipe referenced]. FS Date: 5/13/2015					

Photo 1 of 3 : UCIP_SP_2018_51699_45192.jpg



WS view: exposed steel pipe (right) on channel bank.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.58	03/12/2018 03/12/2018	Maksim Khashchuk

LM Start	2.12	Rating **	M	Issue No.	980 (cont)	
LM End	2.12	Issue Type +	Ma	Location *		
Category	Supplemental			GPS Latitude/Longitude		
				Start		End
Item	DWR UCIP LMA Responsibility			37.803886 °	37.803886 °	
				-121.386271 °	-121.386271 °	
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:51699						
DS_ID:22706						
EP_NO: N/A						
Repair Type: Non-Urgent						
Crossing Status: Found						
UCIP Comments: Leaky and damaged siphon breaker on waterside shoulder..						
FIELD_STRUCT_DESC: 16-inch steel drainage discharge pipe through the levee, 8 feet below the crown. Pump on a concrete sump in a drainage ditch on the landside (LS) toe. Siphon breaker on the waterside (WS) shoulder. [Additional Reference(s): USACE San Joaquin O&M Manual 10, March 1964, (HLM 2.14), 12-inch pipe referenced].						
FS Date: 5/13/2015						

LM Start	2.12	Rating **	M	Issue No.	980 (cont)
LM End	2.12	Issue Type +	Ma	Location *	

Photo 2 of 3 : UCIP_SP_2018_51699_45191.jpg



WS view: siphon breaker on concrete pad on levee slope.

Photo 3 of 3 : UCIP_SP_2018_51699_45190.jpg



WS view: Upper part of the siphon breaker missing.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.58	03/12/2018 03/12/2018	Maksim Khashchuk

LM Start	2.19	Rating **	C	Issue No.	37
LM End	3.07	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		37.803571 °	37.799716 °	
			-121.385011 °	-121.369848 °	
DWR ID	DWR_RD2058_01_f_2017_37				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

LM Start	2.19	Rating **	C	Issue No.	36
LM End	3.07	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		37.803572 °	37.799716 °	
			-121.385010 °	-121.369848 °	
DWR ID	DWR_RD2058_01_f_2017_36				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

LM Start	2.39	Rating **	A/W	Issue No.	16
LM End	2.39	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		37.802782 °	37.802782 °	
			-121.381413 °	-121.381413 °	
DWR ID	DWR_RD2058_01_s_2012_16				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					
Elderberry growing on landside toe. The LMA maintains the shrub to allow visibility.					

No Photos

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.58	03/12/2018 03/12/2018	Maksim Khashchuk

LM Start	2.61	Rating **	A/W	Issue No.	63
LM End	2.61	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			37.801962 °	37.801962 °
				-121.377684 °	-121.377684 °
DWR ID	DWR_RD2058_01_s _ 2012_63				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					
Elderberry on waterside slope.					

No Photos

LM Start	2.63	Rating **	A/W	Issue No.	64
LM End	2.63	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			37.801876 °	37.801876 °
				-121.377291 °	-121.377291 °
DWR ID	DWR_RD2058_01_s _ 2012_64				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.58	03/12/2018 03/12/2018	Maksim Khashchuk

LM Start	2.64	Rating **	A/W	Issue No.	65
LM End	2.64	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			37.801823 °	37.801823 °
				-121.377068 °	-121.377068 °
DWR ID	DWR_RD2058_01_s _ 2012_65				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					

No Photos

LM Start	2.72	Rating **	A/W	Issue No.	66
LM End	2.72	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			37.801497 °	37.801497 °
				-121.375586 °	-121.375586 °
DWR ID	DWR_RD2058_01_s _ 2012_66				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					

No Photos

LM Start	3.16	Rating **	C	Issue No.	39
LM End	3.58	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			37.798900 °	37.793686 °
				-121.368570 °	-121.364578 °
DWR ID	DWR_RD2058_01_f _ 2017_39				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.58	03/12/2018 03/12/2018	Maksim Khashchuk

LM Start	3.16	Rating **	C	Issue No.	38
LM End	4.85	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			37.798900 °	37.784809 °
				-121.368569 °	-121.349662 °
DWR ID	DWR_RD2058_01_f_2017_38				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

LM Start	3.53	Rating **	A/W	Issue No.	68
LM End	3.53	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			37.794396 °	37.794396 °
				-121.364944 °	-121.364944 °
DWR ID	DWR_RD2058_01_s_2012_68				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					
The LMA maintains the shrub to allow visibility.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.58	03/12/2018 03/12/2018	Maksim Khashchuk

LM Start	3.72	Rating **	M	Issue No.	974
LM End	3.72	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			37.791856 °	37.791856 °
				-121.363514 °	-121.363514 °
DWR ID	DWR_RD2058_01_s _ 2012_974				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					
Flagged bushes obstructing visibility and access.					

No Photos

LM Start	3.96	Rating **	U	Issue No.	26
LM End	3.96	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			37.789128 °	37.789128 °
				-121.361042 °	-121.361042 °
DWR ID	DWR_RD2058_01_s _ 2012_26				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					
Elderberry on landside hinge point.					

No Photos

LM Start	3.97	Rating **	A/W	Issue No.	69
LM End	3.97	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			37.789062 °	37.789062 °
				-121.360848 °	-121.360848 °
DWR ID	DWR_RD2058_01_s _ 2012_69				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					

No Photos

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.58	03/12/2018 03/12/2018	Maksim Khashchuk

LM Start	4.31	Rating **	A/W	Issue No.	71
LM End	4.31	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			37.789794 °	37.789794 °
				-121.354883 °	-121.354883 °
DWR ID	DWR_RD2058_01_s_2012_71				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					

No Photos

LM Start	4.43	Rating **	M	Issue No.	1
LM End	4.47	Issue Type +	Ma	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR Erosion Survey			37.789810 °	37.789653 °
				-121.352490 °	-121.351791 °
DWR ID	RD2058U01RM3.97				
Comment Code					
Inspector Comment					
10/10/2017: No significant change observed.					
07/20/2016: No significant change observed.					
08/04/2015: No significant change observed.					
08/26/2014: No significant change observed.					
08/28/2013: No significant change observed.					
07/26/2012: The site has been visited, and no significant change has been observed.					
09/02/2011: This site was not visited due to the time limit.					
09/22/2010: No significant change observed. Minor pocket erosions are lined at the lower bank. Two large Oak and Willow trees are on mid-slope and bench. The remaining bench was re-measured and found to be approximately 10 feet. There was no indication of active erosion on site during the site visit.					
08/05/2010: Recommended for annual assessment and monitoring of the site during flood events, per CLRO.					
07/23/2009: No major change observed since last visit; site is a 200-ft. long near-vertical berm erosion; recommend annual assessment and monitoring of the erosion site, per CLRO CES Evaluation 2008 Report; Site # is the same site previously reported as RM4.0,LM4.51; previously rated "U".					
09/10/2008: Two large trees (2-3' DBH) with partial roots exposed.					
2007: Visited site 03/13/2007. [2017 Site ID:RD2058U01RM3.97]					

Photo 1 of 4 : SP_2018_RD2058_111_1_20180305_00001.jpg



Direct view of the pocket erosion site.

* Location	** Rating	+ Issue Type
LS : Land Side WS : Water Side CR : Crown	A : Acceptable M : Minimally Acceptable U : Unacceptable	Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
N/A : Not Applicable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.58	03/12/2018 03/12/2018	Maksim Khashchuk

LM Start	4.43	Rating **	M	Issue No.	1 (cont)
LM End	4.47	Issue Type +	Ma	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR Erosion Survey			37.789810 °	37.789653 °
				-121.352490 °	-121.351791 °
DWR ID	RD2058U01RM3.97				

Comment Code

Inspector Comment

10/10/2017: No significant change observed.
 07/20/2016: No significant change observed.
 08/04/2015: No significant change observed.
 08/26/2014: No significant change observed.
 08/28/2013: No significant change observed.
 07/26/2012: The site has been visited, and no significant change has been observed.
 09/02/2011: This site was not visited due to the time limit.
 09/22/2010: No significant change observed. Minor pocket erosions are lined at the lower bank. Two large Oak and Willow trees are on mid-slope and bench. The remaining bench was re-measured and found to be approximately 10 feet. There was no indication of active erosion on site during the site visit.
 08/05/2010: Recommended for annual assessment and monitoring of the site during flood events, per CLRO.
 07/23/2009: No major change observed since last visit; site is a 200-ft. long near-vertical berm erosion; recommend annual assessment and monitoring of the erosion site, per CLRO CES Evaluation 2008 Report; Site # is the same site previously reported as RM4.0, LM4.51; previously rated "U".
 09/10/2008: Two large trees (2-3' DBH) with partial roots exposed.
 2007: Visited site 03/13/2007. [2017 Site ID:RD2058U01RM3.97]

LM Start	4.43	Rating **	M	Issue No.	1 (cont)
LM End	4.47	Issue Type +	Ma	Location *	WS

Photo 2 of 4 : SP_2018_RD2058_111_1_20180305_00002.jpg



Direct view of the erosion near a tree.

Photo 3 of 4 : SP_2018_RD2058_111_1_20180305_00003.jpg



Close view of the erosion.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.58	03/12/2018 03/12/2018	Maksim Khashchuk

LM Start	4.43	Rating **	M	Issue No.	1 (cont)
LM End	4.47	Issue Type +	Ma	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR Erosion Survey			37.789810 °	37.789653 °
				-121.352490 °	-121.351791 °
DWR ID	RD2058U01RM3.97				
Comment Code					
Inspector Comment					
10/10/2017: No significant change observed.					
07/20/2016: No significant change observed.					
08/04/2015: No significant change observed.					
08/26/2014: No significant change observed.					
08/28/2013: No significant change observed.					
07/26/2012: The site has been visited, and no significant change has been observed.					
09/02/2011: This site was not visited due to the time limit.					
09/22/2010: No significant change observed. Minor pocket erosions are lined at the lower bank. Two large Oak and Willow trees are on mid-slope and bench. The remaining bench was re-measured and found to be approximately 10 feet. There was no indication of active erosion on site during the site visit.					
08/05/2010: Recommended for annual assessment and monitoring of the site during flood events, per CLRO.					
07/23/2009: No major change observed since last visit; site is a 200-ft. long near-vertical berm erosion; recommend annual assessment and monitoring of the erosion site, per CLRO CES Evaluation 2008 Report; Site # is the same site previously reported as RM4.0,LM4.51; previously rated "U".					
09/10/2008: Two large trees (2-3' DBH) with partial roots exposed.					
2007: Visited site 03/13/2007. [2017 Site ID:RD2058U01RM3.97]					

Photo 4 of 4 : SP_2018_RD2058_111_1_20180305_00004.jpg



Direct view of the erosion near a tree.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.58	03/12/2018 03/12/2018	Maksim Khashchuk

LM Start	4.63	Rating **	A/W	Issue No.	43
LM End		Issue Type +	Ma	Location *	
Category	Supplemental		GPS Latitude/Longitude		
			Start	End	
Item	2017 Storm Damage		37.787800 °	°	
			-121.350860 °	°	

DWR ID DWR_RD2058_01_f_2017_43

Comment Code

Inspector Comment

Levee Evaluation Comments

Description:

Site ID No:82

Site Designation:LMA-36

Repair Type: Erosion

Rating:Area of Concern

Field Date:6/8/2017

Notes: vegetation too dense to evaluate damage. Erosion on the waterside is greater than three feet tall into the levee prism as of Fall 2017 Inspection. Turned back over to Evaluators for re-assessment.

LM Start	4.63	Rating **	A/W	Issue No.	43 (cont)
LM End		Issue Type +	Ma	Location *	

Photo 1 of 3 : LEVAL_SP_2018_82_1348.jpg



Photo 2 of 3 : LEVAL_SP_2018_82_1354.jpg



* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.58	03/12/2018 03/12/2018	Maksim Khashchuk

LM Start	4.63	Rating **	A/W	Issue No.	43 (cont)	
LM End		Issue Type +	Ma	Location *		
Category	Supplemental			GPS Latitude/Longitude		
				Start	End	
Item	2017 Storm Damage			37.787800 °		
				-121.350860 °		
DWR ID	DWR_RD2058_01_f_2017_43					
Comment Code						
Inspector Comment						
Levee Evaluation Comments						
Description:						
Site ID No:82						
Site Designation:LMA-36						
Repair Type: Erosion						
Rating:Area of Concern						
Field Date:6/8/2017						
Notes: vegetation too dense to evaluate damage. Erosion on the waterside is greater than three feet tall into the levee prism as of Fall 2017 Inspection. Turned back over to Evaluators for re-assessment.						

Photo 3 of 3 : LEVAL_SP_2018_82_1355.jpg



LM Start	4.63	Rating **	A/W	Issue No.	40
LM End	4.76	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Erosion / Bank Caving			37.787756 °	37.785971 °
				-121.350851 °	-121.350372 °
DWR ID	DWR_RD2058_01_f_2017_40				
Comment Code					
E2 : Schedule repair of erosion site prior to the next inspection.					
Inspector Comment					
Erosion on the waterside is greater than three feet tall into the levee prism.					

Photo 1 of 5 : SP_2018_RD2058_111_40_20180305_00030.jpg



Downstream view of the erosion.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.58	03/12/2018 03/12/2018	Maksim Khashchuk

LM Start	4.63	Rating **	A/W	Issue No.	40 (cont)	
LM End	4.76	Issue Type +	Ma	Location *	WS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start	End	
Item	Erosion / Bank Caving			37.787756 °	37.785971 °	
				-121.350851 °	-121.350372 °	
DWR ID	DWR_RD2058_01_f_2017_40					
Comment Code						
E2 : Schedule repair of erosion site prior to the next inspection.						
Inspector Comment						
Erosion on the waterside is greater than three feet tall into the levee prism.						


Photo 2 of 5 : SP_2018_RD2058_111_40_20180305_00031.jpg



Another downstream view of the erosion.

LM Start	4.63	Rating **	A/W	Issue No.	40 (cont)
LM End	4.76	Issue Type +	Ma	Location *	WS

Photo 3 of 5 : SP_2018_RD2058_111_40_20180305_00032.jpg

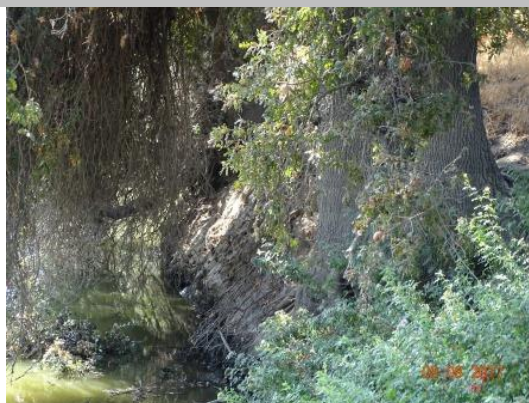

Upstream view of the erosion site.

LM Start	4.63	Rating **	A/W	Issue No.	40 (cont)
LM End	4.76	Issue Type +	Ma	Location *	WS

Photo 4 of 5 : SP_2018_RD2058_111_40_20180305_00033.jpg



Another upstream view of the erosion site.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.58	03/12/2018 03/12/2018	Maksim Khashchuk

LM Start	4.63	Rating **	A/W	Issue No.	40 (cont)	
LM End	4.76	Issue Type +	Ma	Location *	WS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start		End
Item	Erosion / Bank Caving			37.787756 °		37.785971 °
				-121.350851 °		-121.350372 °
DWR ID	DWR_RD2058_01_f_2017_40					
Comment Code						
E2 : Schedule repair of erosion site prior to the next inspection.						
Inspector Comment						
Erosion on the waterside is greater than three feet tall into the levee prism.						

Photo 5 of 5 : SP_2018_RD2058_111_40_20180305_00034.jpg



Erosion on the bank looking upstream.

LM Start	4.76	Rating **	A/W	Issue No.	15
LM End	4.83	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Erosion / Bank Caving			37.785965 °	37.785045 °
				-121.350374 °	-121.349936 °
DWR ID	DWR_RD2058_01_f_2013_15				
Comment Code					
E1 : Note and monitor erosion site.					
Inspector Comment					
The erosion has about a 3 foot vertical cut at the waterside levee toe.					

Photo 1 of 3 : SP_2018_RD2058_111_15_20180305_00008.jpg



View of the erosion at the waterside levee toe.

LM Start	4.76	Rating **	A/W	Issue No.	15 (cont)
LM End	4.83	Issue Type +	Ma	Location *	WS

Photo 2 of 3 : SP_2018_RD2058_111_15_20180305_00009.jpg



Upstream view of the erosion.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.58	03/12/2018 03/12/2018	Maksim Khashchuk

LM Start	4.76	Rating **	A/W	Issue No.	15 (cont)	
LM End	4.83	Issue Type +	Ma	Location *	WS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start		End
Item	Erosion / Bank Caving			37.785965 °		37.785045 °
				-121.350374 °		-121.349936 °
DWR ID	DWR_RD2058_01_f_2013_15					
Comment Code						
E1 : Note and monitor erosion site.						
Inspector Comment						
The erosion has about a 3 foot vertical cut at the waterside levee toe.						

Photo 3 of 3 : SP_2018_RD2058_111_15_20180305_00010.jpg



Downstream view of the erosion site.

LM Start	4.77	Rating **	A/W	Issue No.	44
LM End		Issue Type +	Ma	Location *	
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	2017 Storm Damage			37.785862 °	°
				-121.350303 °	°
DWR ID	DWR_RD2058_01_f_2017_44				
Comment Code					
Inspector Comment					
Levee Evaluation Comments					
Description:					
Site ID No:100					
Site Designation:FSRP-14-25					
Repair Type: Erosion					
Rating:Area of Concern					
Field Date:6/8/2017					
Notes: vegetation too dense to evaluate damage. The erosion has about a 3 foot vertical cut at the waterside levee toe as of the Fall 2017 Inspection. Turned back over to Evaluators for re-assessment.					

Photo 1 of 3 : LEVAL_SP_2018_100_1357.jpg



* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.58	03/12/2018 03/12/2018	Maksim Khashchuk

LM Start	4.77	Rating **	A/W	Issue No.	44 (cont)	
LM End		Issue Type +	Ma	Location *		
Category	Supplemental			GPS Latitude/Longitude		
				Start		End
Item	2017 Storm Damage			37.785862 °		°
				-121.350303 °		°
DWR ID	DWR RD2058 01 f 2017 44					

Comment Code

Inspector Comment

Levee Evaluation Comments

Description:

Site ID No:100

Site Designation:FSRP-14-25

Repair Type: Erosion

Rating:Area of Concern

Field Date:6/8/2017

Notes: vegetation too dense to evaluate damage. The erosion has about a 3 foot vertical cut at the waterside levee toe as of the Fall 2017 Inspection. Turned back over to Evaluators for re-assessment.

LM Start	4.77	Rating **	A/W	Issue No.	44 (cont)
LM End		Issue Type +	Ma	Location *	

Photo 2 of 3 : LEVAL_SP_2018_100_1359.jpg



Photo 3 of 3 : LEVAL_SP_2018_100_1361.jpg



* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.58	03/12/2018 03/12/2018	Maksim Khashchuk

LM Start	4.89	Rating **	C	Issue No.	41
LM End	5.52	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		37.784548 °	37.780065 °	
			-121.348940 °	-121.340029 °	
DWR ID	DWR_RD2058_01_f_2017_41				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

LM Start	5.63	Rating **	A/W	Issue No.	25
LM End	5.63	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Animal Control		37.778515 °	37.778515 °	
			-121.339136 °	-121.339136 °	
DWR ID	DWR_RD2058_01_s_2016_25				
Comment Code					
A1 : Exterminate rodents and backfill and compact or grout burrows.					
Inspector Comment					
Monitor this area for rodent activity.					

No Photos

LM Start	5.71	Rating **	M	Issue No.	33
LM End	5.71	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Erosion / Bank Caving		37.777735 °	37.777735 °	
			-121.338103 °	-121.338103 °	
DWR ID	DWR_RD2058_01_s_2017_33				
Comment Code					
E1 : Note and monitor erosion site.					
Inspector Comment					
The approximate 10 foot berm is eroding towards the levee slope.					

No Photos

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.58	03/12/2018 03/12/2018	Maksim Khashchuk

LM Start	5.97	Rating **	A/W	Issue No.	28
LM End	5.97	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.774886 °	37.774886 °
				-121.335122 °	-121.335122 °
DWR ID	DWR_RD2058_01_s_2016_28				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP_2018_RD2058_111_28_20180305_00016.jpg



View of the rodent holes on the levee slope.

LM Start	6.23	Rating **	M	Issue No.	42
LM End	6.23	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.772613 °	37.772613 °
				-121.331467 °	-121.331467 °
DWR ID	DWR_RD2058_01_f_2017_42				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					
Bait stations installed.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---